AkzoNobel

# **SAFETY DATA SHEET**

## Grip-Gard EFx-LV Toner B664 Blue Transparent

## **Section 1. Identification**

GHS product identifier Other means of identification	<ul> <li>Grip-Gard EFx-LV Toner B664 Blue Transparent</li> <li>509981</li> </ul>
Relevant identified uses of the	substance or mixture and uses advised against : FOR INDUSTRIAL USE ONLY
Supplier/Manufacturer	: Akzo Nobel Coatings, Inc. 1845 Maxwell Troy, MI, 48084 USA (800) 618-1010
Canadian Supplier	: Akzo Nobel Coatings Ltd. 110 Woodbine Downs Blvd. Unit #4 Etobicoke, Ontario Canada M9W 5S6 +1 (800) 618-1010
Emergency telephone number	: CHEMTREC +1 (800) 424-9300 (Inside the US) CHEMTREC International +1 (703) 527-3887 (Outside the US, collect calls accepted)
Date of issue / Date of revision Safety Data Sheet Version Date of printing	<ul> <li>13 November 2015</li> <li>12.05</li> <li>13 November 2015</li> </ul>

Akzo Nobel Coatings Inc. encourages and expects you to read and understand this entire MSDS, as there is important information throughout the document. Further, Akzo Nobel Coatings Inc. expects you to follow the precautions identified in this document unless your use conditions would necessitate other appropriate methods or actions.

To promote safe handling, each customer or recipient should: 1) Notify its employees, agents, contractors, and others whom it knows or believes will use this material of the information contained in this MSDS and any other information regarding hazards and safety; 2) Furnish this same information to each of its customers for the product; 3) Request its customers to notify their employees, customers, and other users of the product of this information; and 4) Notify its employees, agents, contractors, and others that the precautions identified for this product and any other products with which mixtures may be created are transferable and cumulative to the mixture.

## Section 2. Hazards identification

OSHA/HCS status	: This material is considered hazardous by the OSHA Hazard Communication Standard (29 CFR 1910.1200).
Classification of the substance or mixture	<ul> <li>FLAMMABLE LIQUIDS - Category 3 SKIN SENSITIZATION - Category 1 SPECIFIC TARGET ORGAN TOXICITY (SINGLE EXPOSURE) (Narcotic effects) - Category 3</li> </ul>
	Percentage of the mixture consisting of ingredient(s) of unknown toxicity: 63.8%

### GHS label elements

For additional information call the Akzo Nobel Car Refinishes Techline at 1-800-618-1010.

P	ac	le:	2/	1	4

Section 2. Hazards identification		
Hazard pictograms		
Signal word	: Warning	
Hazard statements	<ul> <li>Flammable liquid and vapour.</li> <li>May cause an allergic skin reaction.</li> <li>May cause drowsiness or dizziness.</li> </ul>	
Precautionary statements	5	
Prevention	: Wear protective gloves. Wear eye or face protection. Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking. Use explosion-proof electrical, ventilating, lighting and all material-handling equipment. Use only non-sparking tools. Take precautionary measures against static discharge. Keep container tightly closed. Use only outdoors or in a well-ventilated area. Avoid breathing vapor. Contaminated work clothing should not be allowed out of the workplace.	
Response	: IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable for breathing. Call a POISON CENTER or physician if you feel unwell. IF ON SKIN (or hair): Take off immediately all contaminated clothing. Rinse skin with water or shower. IF ON SKIN: Wash with plenty of soap and water. If skin irritation or rash occurs: Get medical attention.	
Storage	: Store locked up. Store in a well-ventilated place. Keep cool.	
Disposal	: Dispose of contents and container in accordance with all local, regional, national and international regulations.	
Hazards not otherwise classified	: None known.	

# Section 3. Composition/information on ingredients

Substance/mixture

: Mixture

Ingredient name	%	CAS number
n-butyl acetate Solvent naphtha (petroleum), light arom. heptan-2-one 1,2,4-trimethylbenzene [N,N,N',N',N'',N''-hexaethyl-29H,31H-phthalocyaninetrimethylaminato(2-)- N29,N30,N31,N32]copper	15 - 20 5 - 10 1 - 5 1 - 5 0 - 1	123-86-4 64742-95-6 110-43-0 95-63-6 28654-73-1

Occupational exposure limits, if available, are listed in Section 8.

## Section 4. First aid measures

### Description of necessary first aid measures

```
Eye contact
```

: Immediately flush eyes with plenty of water, occasionally lifting the upper and lower eyelids. Check for and remove any contact lenses. Continue to rinse for at least 10 minutes. Get medical attention if irritation occurs.

For additional information call the Akzo Nobel Car Refinishes Techline at 1-800-618-1010.

# Section 4. First aid measures

Inhalation	: Remove victim to fresh air and keep at rest in a position comfortable for breathing. If it is suspected that fumes are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. If not breathing, if breathing is irregular or if respiratory arrest occurs, provide artificial respiration or oxygen by trained personnel. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. Get medical attention. If necessary, call a poison center or physician. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband. In case of inhalation of decomposition products in a fire, symptoms may be delayed. The exposed person may need to be kept under medical surveillance for 48 hours.
Skin contact	: Wash with plenty of soap and water. Remove contaminated clothing and shoes. Wash contaminated clothing thoroughly with water before removing it, or wear gloves. Continue to rinse for at least 10 minutes. Get medical attention. In the event of any complaints or symptoms, avoid further exposure. Wash clothing before reuse. Clean shoes thoroughly before reuse.
Ingestion	: Wash out mouth with water. Remove dentures if any. Remove victim to fresh air and keep at rest in a position comfortable for breathing. If material has been swallowed and the exposed person is conscious, give small quantities of water to drink. Stop if the exposed person feels sick as vomiting may be dangerous. Do not induce vomiting unless directed to do so by medical personnel. If vomiting occurs, the head should be kept low so that vomit does not enter the lungs. Get medical attention. If necessary, call a poison center or physician. Never give anything by mouth to an unconscious person. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband.

### Most important symptoms/effects, acute and delayed

### Potential acute health effects

I otential acute health enects	
Eye contact	No known significant effects or critical hazards.
Inhalation :	Can cause central nervous system (CNS) depression. May cause drowsiness or dizziness. Exposure to decomposition products may cause a health hazard. Serious effects may be delayed following exposure.
Skin contact	May cause an allergic skin reaction.
Ingestion :	Can cause central nervous system (CNS) depression.
Over-exposure signs/sympton	<u>ns</u>
Eye contact	No specific data.
Inhalation :	Adverse symptoms may include the following: nausea or vomiting headache drowsiness/fatigue dizziness/vertigo unconsciousness
Skin contact	Adverse symptoms may include the following: irritation redness
Ingestion :	No specific data.

#### Indication of immediate medical attention and special treatment needed, if necessary

For additional information call the Akzo Nobel Car Refinishes Techline at 1-800-618-1010.

# Section 4. First aid measures

Notes to physician	<ul> <li>In case of inhalation of decomposition products in a fire, symptoms may be delayed.</li> <li>The exposed person may need to be kept under medical surveillance for 48 hours.</li> </ul>
Specific treatments	: No specific treatment.
Protection of first-aiders	: No action shall be taken involving any personal risk or without suitable training. If it is suspected that fumes are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. Wash contaminated clothing thoroughly with water before removing it, or wear gloves.

See toxicological information (Section 11)

# Section 5. Fire-fighting measures

: Use dry chemical, CO <sub>2</sub> , water spray (fog) or foam.
: Do not use water jet.
: Flammable liquid and vapour. In a fire or if heated, a pressure increase will occur and the container may burst, with the risk of a subsequent explosion. Runoff to sewer may create fire or explosion hazard.
: Decomposition products may include the following materials: carbon dioxide carbon monoxide nitrogen oxides metal oxide/oxides
Promptly isolate the scene by removing all persons from the vicinity of the incident if there is a fire. No action shall be taken involving any personal risk or without suitable training. Move containers from fire area if this can be done without risk. Use water spray to keep fire-exposed containers cool.
: Fire-fighters should wear appropriate protective equipment and self-contained breathing apparatus (SCBA) with a full face-piece operated in positive pressure mode.

# Section 6. Accidental release measures

Personal precautions, protective equipment and emergency procedures			
For non-emergency personnel	: No action shall be taken involving any personal risk or without suitable training. Evacuate surrounding areas. Keep unnecessary and unprotected personnel from entering. Do not touch or walk through spilled material. Shut off all ignition sources. No flares, smoking or flames in hazard area. Avoid breathing vapor or mist. Provide adequate ventilation. Wear appropriate respirator when ventilation is inadequate. Put on appropriate personal protective equipment.		
For emergency responders	: If specialised clothing is required to deal with the spillage, take note of any information in Section 8 on suitable and unsuitable materials. See also the information in "For non-emergency personnel".		

For additional information call the Akzo Nobel Car Refinishes Techline at 1-800-618-1010.

To request an updated SDS please visit http://www.formstack.com/forms/AkzoNobel-document\_request\_form

# Section 6. Accidental release measures

Environmental precautions	<ul> <li>Avoid dispersal of spilled material and runoff and contact with soil, waterways, drains and sewers. Inform the relevant authorities if the product has caused environmental pollution (sewers, waterways, soil or air).</li> </ul>
Methods and materials for co	ontainment and cleaning up
Small spill	: Stop leak if without risk. Move containers from spill area. Use spark-proof tools and explosion-proof equipment. Dilute with water and mop up if water-soluble. Alternatively, or if water-insoluble, absorb with an inert dry material and place in an appropriate waste disposal container. Dispose of via a licensed waste disposal contractor.
Large spill	: Stop leak if without risk. Move containers from spill area. Use spark-proof tools and explosion-proof equipment. Approach release from upwind. Prevent entry into sewers, water courses, basements or confined areas. Wash spillages into an effluent treatment plant or proceed as follows. Contain and collect spillage with non-combustible, absorbent material e.g. sand, earth, vermiculite or diatomaceous earth and place in container for disposal according to local regulations (see Section 13). Dispose of via a licensed waste disposal contractor. Contaminated absorbent material may pose the same hazard as the spilled product. Note: see Section 1 for emergency contact information and Section 13 for waste disposal.

# Section 7. Handling and storage

## Precautions for safe handling

Protective measures	Put on appropriate personal protective equipment (see Section 8). Persons with a history of skin sensitization problems should not be employed in any process in which this product is used. Do not get in eyes or on skin or clothing. Do not ingest. Avoid breathing vapor or mist. Use only with adequate ventilation. Wear appropriate respirator when ventilation is inadequate. Do not enter storage areas and confined spaces unless adequately ventilated. Keep in the original container or an approved alternative made from a compatible material, kept tightly closed when not in use. Store and use away from heat, sparks, open flame or any other ignition source. Use explosion-proof electrical (ventilating, lighting and material handling) equipment. Use only non-sparking tools. Take precautionary measures against electrostatic discharges. Empty containers retain product residue and can be hazardous. Do not reuse container.
Advice on general occupational hygiene	Eating, drinking and smoking should be prohibited in areas where this material is handled, stored and processed. Workers should wash hands and face before eating, drinking and smoking. Remove contaminated clothing and protective equipment before entering eating areas. See also Section 8 for additional information on hygiene measures.
Conditions for safe storage, including any incompatibilities	Store in accordance with local regulations. Store in a segregated and approved area. Store in original container protected from direct sunlight in a dry, cool and well- ventilated area, away from incompatible materials (see Section 10) and food and drink. Store locked up. Eliminate all ignition sources. Separate from oxidizing materials. Keep container tightly closed and sealed until ready for use. Containers that have been opened must be carefully resealed and kept upright to prevent leakage. Do not store in unlabeled containers. Use appropriate containment to avoid environmental contamination.

For additional information call the Akzo Nobel Car Refinishes Techline at 1-800-618-1010. To request an updated SDS please visit http://www.formstack.com/forms/AkzoNobel-document\_request\_form

## Section 8. Exposure controls/personal protection

#### **Control parameters**

#### **Occupational exposure limits**

Ingredient name	Exposure limits
n-butyl acetate	ACGIH TLV (United States, 3/2015).
	STEL: 200 ppm 15 minutes.
	TWA: 150 ppm 8 hours.
	NIOSH REL (United States, 10/2013).
	STEL: 950 mg/m <sup>3</sup> 15 minutes.
	STEL: 200 ppm 15 minutes.
	TWA: 710 mg/m <sup>3</sup> 10 hours.
	TWA: 150 ppm 10 hours.
	OSHA PEL (United States, 2/2013).
	TWA: 710 mg/m <sup>3</sup> 8 hours.
	TWA: 150 ppm 8 hours.
heptan-2-one	ACGIH TLV (United States, 3/2015).
	TWA: 233 mg/m <sup>3</sup> 8 hours.
	TWA: 50 ppm 8 hours.
	NIOSH REL (United States, 10/2013).
	TWA: 465 mg/m <sup>3</sup> 10 hours.
	TWA: 100 ppm 10 hours.
	OSHA PEL (United States, 2/2013).
	TWA: 465 mg/m <sup>3</sup> 8 hours.
	TWA: 100 ppm 8 hours.
1,2,4-trimethylbenzene	ACGIH TLV (United States, 3/2015).
-	TWA: 123 mg/m <sup>3</sup> 8 hours.
	TWA: 25 ppm 8 hours.
	NIOSH REL (United States, 10/2013).
	TWA: 125 mg/m <sup>3</sup> 10 hours.
	TWA: 25 ppm 10 hours.

Appropriate engineering : controls	Use only with adequate ventilation. Use process enclosures, local exhaust ventilation or other engineering controls to keep worker exposure to airborne contaminants below any recommended or statutory limits. The engineering controls also need to keep gas, vapor or dust concentrations below any lower explosive limits. Use explosion-proof ventilation equipment.
Environmental exposure : controls	Emissions from ventilation or work process equipment should be checked to ensure they comply with the requirements of environmental protection legislation. In some cases, fume scrubbers, filters or engineering modifications to the process equipment will be necessary to reduce emissions to acceptable levels.
Individual protection measures	

 Hygiene measures
 : Wash hands, forearms and face thoroughly after handling chemical products, before eating, smoking and using the lavatory and at the end of the working period. Appropriate techniques should be used to remove potentially contaminated clothing. Contaminated work clothing should not be allowed out of the workplace. Wash contaminated clothing before reusing. Ensure that eyewash stations and safety showers are close to the workstation location.

For additional information call the Akzo Nobel Car Refinishes Techline at 1-800-618-1010.

Page: 7/14

# Section 8. Exposure controls/personal protection

: Safety eyewear complying with an approved standard should be used when a risk assessment indicates this is necessary to avoid exposure to liquid splashes, mists, gases or dusts. If contact is possible, the following protection should be worn, unless the assessment indicates a higher degree of protection: safety glasses with side-shields.
: Chemical-resistant, impervious gloves complying with an approved standard should be worn at all times when handling chemical products if a risk assessment indicates this is necessary. Considering the parameters specified by the glove manufacturer, check during use that the gloves are still retaining their protective properties. It should be noted that the time to breakthrough for any glove material may be different for different glove manufacturers. In the case of mixtures, consisting of several substances, the protection time of the gloves cannot be accurately estimated.
: Personal protective equipment for the body should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product. When there is a risk of ignition from static electricity, wear anti-static protective clothing. For the greatest protection from static discharges, clothing should include anti-static overalls, boots and gloves.
: Appropriate footwear and any additional skin protection measures should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product.
: Use a properly fitted, air-purifying or air-fed respirator complying with an approved standard if a risk assessment indicates this is necessary. Respirator selection must be based on known or anticipated exposure levels, the hazards of the product and the safe working limits of the selected respirator.

# Section 9. Physical and chemical properties

Appearanc	е
-----------	---

Physical state	:	Liquid.	
	:	Not available.	
Odor	:	NOT AVAILABLE. (CAPITAL-PERIOD)	
Odor threshold	:	Not available.	
рН	:	Not available.	
Melting/freezing point	:	Not available.	
Boiling point	:	126°C (258.8°F)	
boiling range	:	Not available.	
Flash point	:	Closed cup: 27°C (80.6°F)	
Evaporation rate : Not available.			
Flammability (solid, gas)	:	Not available.	
Upper/lower flammability or exp	olo	osive limits	
Upper:	: Not determined.		
Lower:	:	Not determined.	
Vapor pressure	:	Not available.	
Vapor density	: Not available.		
Relative density : 1.056			
Density	:	8.81 lbs/gal 1.056 g/cm <sup>3</sup>	

For additional information call the Akzo Nobel Car Refinishes Techline at 1-800-618-1010.

Section 9. Physical and chemical properties		
Solubility	: Not available.	
Solubility in water	: Not available.	
Partition coefficient: n- octanol/water	: Not available.	
Auto-ignition temperature	: Not available.	
Decomposition temperature	: Not available.	
Viscosity	: Kinematic (room temperature): 4.26 cm <sup>2</sup> /s (426 cSt)	
Weight Volatiles	: 34.26% (w/w)	
Volume Volatiles	: 41.17 %(v/v)	
Weight Solids	: 65.74 <sup>%(w/w)</sup>	
Volume Solids	: 58.83 %(v/v)	
Regulatory VOC	: 3.02 lbs/gal (362 g/l) minus water and exempt solvents	
Continue 40. Ctabili		

## Section 10. Stability and reactivity

Reactivity	: No specific test data related to reactivity available for this product or its ingredients.
Chemical stability	: The product is stable.
Possibility of hazardous reactions	: Under normal conditions of storage and use, hazardous reactions will not occur.
Conditions to avoid	: Avoid all possible sources of ignition (spark or flame). Do not pressurize, cut, weld, braze, solder, drill, grind or expose containers to heat or sources of ignition.
Incompatible materials	: Reactive or incompatible with the following materials: oxidizing materials
Hazardous decomposition products	: Under normal conditions of storage and use, hazardous decomposition products should not be produced.

# Section 11. Toxicological information

## Information on toxicological effects

### Acute toxicity

Product/ingredient name	Result	Species	Dose	Exposure
n-butyl acetate	LC50 Inhalation Vapor	Rat	390 ppm	4 hours
-	LD50 Dermal	Rabbit	>17600 mg/kg	-
	LD50 Oral	Rat	10768 mg/kg	-
Solvent naphtha (petroleum), light arom.	LD50 Oral	Rat	8400 mg/kg	-
heptan-2-one 1,2,4-trimethylbenzene	LD50 Oral LD50 Oral	Rat Rat	1600 mg/kg 5 g/kg	-

## Irritation/Corrosion

For additional information call the Akzo Nobel Car Refinishes Techline at 1-800-618-1010.

Page: 9/14

# Section 11. Toxicological information

Product/ingredient name	Result	Species	Score	Exposure	Observation
n-butyl acetate	Eyes - Moderate irritant	Rabbit	-	100 milligrams	-
	Skin - Moderate irritant	Rabbit	-	24 hours 500 milligrams	-
Solvent naphtha (petroleum), light arom.	Eyes - Mild irritant	Rabbit	-	24 hours 100 microliters	-
heptan-2-one	Skin - Mild irritant	Rabbit	-	24 hours 14 milligrams	-

## Sensitization

Not available.

#### **Mutagenicity**

Not available.

**Carcinogenicity** 

Not available.

#### **Reproductive toxicity**

Not available.

### **Teratogenicity**

Not available.

#### Specific target organ toxicity (single exposure)

Name	Category	Route of exposure	Target organs
n-butyl acetate	Category 3	Not applicable.	Narcotic effects
Solvent naphtha (petroleum), light arom.	Category 3	Not applicable.	Respiratory tract irritation and Narcotic effects
heptan-2-one	Category 3	Not applicable.	Narcotic effects
1,2,4-trimethylbenzene	Category 3	Not applicable.	Respiratory tract irritation

## Specific target organ toxicity (repeated exposure)

Not available.

#### Aspiration hazard

Name	Result
Solvent naphtha (petroleum), light arom.	ASPIRATION HAZARD - Category 1

Information on the likely routes of exposure	:	Not available.
Potential acute health effects	2	
Eye contact	:	No known significant effects or critical hazards.
Inhalation	:	Can cause central nervous system (CNS) depression. May cause drowsiness or dizziness. Exposure to decomposition products may cause a health hazard. Serious effects may be delayed following exposure.

For additional information call the Akzo Nobel Car Refinishes Techline at 1-800-618-1010.

Ingestion

### Grip-Gard EFx-LV Toner B664 Blue Transparent

Page: 10/14
-------------

# Section 11. Toxicological information

	okioologioal illoritation
Skin contact	: May cause an allergic skin reaction.
Ingestion	: Can cause central nervous system (CNS) depression.
Symptoms related to	the physical, chemical and toxicological characteristics
Eye contact	: No specific data.
Inhalation	: Adverse symptoms may include the following: nausea or vomiting headache drowsiness/fatigue dizziness/vertigo unconsciousness
Skin contact	: Adverse symptoms may include the following: irritation redness

: No specific data.

### Delayed and immediate effects and also chronic effects from short and long term exposure

Short term exposure	
Potential immediate effects	: Not available.
Potential delayed effects	: Not available.
Long term exposure	
Potential immediate effects	: Not available.
Potential delayed effects	: Not available.
Potential chronic health ef	<u>lects</u>
Not available.	
General	: Once sensitized, a severe allergic reaction may occur when subsequently exposed to very low levels.
Carcinogenicity	: No known significant effects or critical hazards.
Mutagenicity	: No known significant effects or critical hazards.
Teratogenicity	: No known significant effects or critical hazards.
Developmental effects	: No known significant effects or critical hazards.
Fertility effects	: No known significant effects or critical hazards.

## Numerical measures of toxicity

### Acute toxicity estimates

Route	ATE value	
Oral	13287 mg/kg	
Inhalation (gases)	59934.4 ppm	
Inhalation (vapors)	64.15 mg/l	
Inhalation (dusts and mists)	19.98 mg/l	

For additional information call the Akzo Nobel Car Refinishes Techline at 1-800-618-1010.

## Section 12. Ecological information

## **Toxicity**

Product/ingredient name	Result	Species	Exposure
n-butyl acetate	Acute LC50 32000 µg/l Marine water	Crustaceans - Artemia salina - Nauplii	48 hours
	Acute LC50 62000 µg/l	Fish - Danio rerio	96 hours
heptan-2-one	Acute LC50 131000 to 137000 μg/l Fresh water	Fish - Pimephales promelas	96 hours
1,2,4-trimethylbenzene	Acute LC50 4910 µg/l Marine water	Crustaceans - Elasmopus pectenicrus - Adult	48 hours
	Acute LC50 22.4 mg/l Fresh water	Fish - Tilapia zillii	96 hours

#### Persistence and degradability

Not available.

#### **Bioaccumulative potential**

Product/ingredient name	LogPow	BCF	Potential
n-butyl acetate Solvent naphtha (petroleum),	2.3	- 10 to 2500	low high
light arom. heptan-2-one 1,2,4-trimethylbenzene	2.26 3.63	- 243	low low

#### Mobility in soil

Soil/water partition	: Not available.
coefficient (Koc)	

Other adverse effects : No known significant effects or critical hazards.

## Section 13. Disposal considerations

Disposal methods : The generation of waste should be avoided or minimized wherever possible. Disposal of this product, solutions and any by-products should at all times comply with the requirements of environmental protection and waste disposal legislation and any regional local authority requirements. Dispose of surplus and non-recyclable products via a licensed waste disposal contractor. Waste should not be disposed of untreated to the sewer unless fully compliant with the requirements of all authorities with jurisdiction. Waste packaging should be recycled. Incineration or landfill should only be considered when recycling is not feasible. This material and its container must be disposed of in a safe way. Care should be taken when handling emptied containers that have not been cleaned or rinsed out. Empty containers or liners may retain some product residues. Vapor from product residues may create a highly flammable or explosive atmosphere inside the container. Do not cut, weld or grind used containers unless they have been cleaned thoroughly internally. Avoid dispersal of spilled material and runoff and contact with soil, waterways, drains and sewers.

For additional information call the Akzo Nobel Car Refinishes Techline at 1-800-618-1010.

## Section 14. Transport information

Special precautions for user : The actual shipping description for this product may vary based several factors including, but not limited to, the volume of material, size of the container, mode of transport and use of exemptions or exceptions found in the applicable regulations. The information provided in Section 14 is one possible shipping description for this product. Consult your shipping specialist or supplier for appropriate assignment of the DOT information.

**Transport within user's premises:** always transport in closed containers that are upright and secure. Ensure that persons transporting the product know what to do in the event of an accident or spillage.

	DOT Classification	TDG Classification	Mexico Classification	IMDG	ΙΑΤΑ
UN number	UN1263	UN1263	UN1263	UN1263	UN1263
UN proper shipping name	PAINT	PAINT	PAINT	PAINT	PAINT
Transport hazard class(es)	3	3	3	3	3
Packing group	III	III	Ш	III	III
Environmental hazards	No.	No.	No.	No.	No.

## Section 15. Regulatory information

U.S. Federal regulations United States inventory : All components are listed or exempted. (TSCA 8b)

## SARA 311/312

Classification : Fire hazard Immediate (acute) health hazard

#### <u>SARA 313</u>

	Product name	CAS number	%
Form R - Reporting requirements	1,2,4-trimethylbenzene	95-63-6	1 - 5

SARA 313 notifications must not be detached from the SDS and any copying and redistribution of the SDS shall include copying and redistribution of the notice attached to copies of the SDS subsequently redistributed.

#### California Prop. 65

For additional information call the Akzo Nobel Car Refinishes Techline at 1-800-618-1010.

To request an updated SDS please visit http://www.formstack.com/forms/AkzoNobel-document\_request\_form

## Section 15. Regulatory information


**WARNING:** This product contains a chemical known to the State of California to cause cancer. **WARNING:** This product contains less than 1% of a chemical known to the State of California to cause birth defects or other reproductive harm.

International lists
---------------------

National inventory	
Australia	: All components are listed or exempted.
Canada	: All components are listed or exempted.
China	: All components are listed or exempted.
Europe	: All components are listed or exempted.
Japan	: All components are listed or exempted.
Malaysia	: At least one component is not listed.
New Zealand	: All components are listed or exempted.
Philippines	: All components are listed or exempted.
Republic of Korea	: At least one component is not listed.
Taiwan	: All components are listed or exempted.

## Section 16. Other information

#### Hazardous Material Information System (U.S.A.)

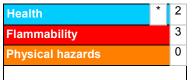

Caution: HMIS® ratings are based on a 0-4 rating scale, with 0 representing minimal hazards or risks, and 4 representing significant hazards or risks Although HMIS® ratings are not required on SDSs under 29 CFR 1910.1200, the preparer may choose to provide them. HMIS® ratings are to be used with a fully implemented HMIS® program. HMIS® is a registered mark of the National Paint & Coatings Association (NPCA). HMIS® materials may be purchased exclusively from J. J. Keller (800) 327-6868.

The customer is responsible for determining the PPE code for this material.

#### National Fire Protection Association (U.S.A.)



Reprinted with permission from NFPA 704-2001, Identification of the Hazards of Materials for Emergency Response Copyright ©1997, National Fire Protection Association, Quincy, MA 02269. This reprinted material is not the complete and official position of the National Fire Protection Association, on the referenced subject which is represented only by the standard in its entirety.

Copyright ©2001, National Fire Protection Association, Quincy, MA 02269. This warning system is intended to be interpreted and applied only by properly trained individuals to identify fire, health and reactivity hazards of chemicals. The user is referred to certain limited number of chemicals with recommended classifications in NFPA 49 and NFPA 325, which would be used as a guideline only. Whether the chemicals are classified by NFPA or not, anyone using the 704 systems to classify chemicals does so at their own risk.

Page: 13/14

For additional information call the Akzo Nobel Car Refinishes Techline at 1-800-618-1010.

To request an updated SDS please visit http://www.formstack.com/forms/AkzoNobel-document\_request\_form

Page: 14/14

## Section 16. Other information

<u>History</u>		
Date of issue/Date of revision	:	13 November 2015
Version	:	12.05
MSDS #	:	019570 0001
Key to abbreviations	:	ATE = Acute Toxicity Estimate BCF = Bioconcentration Factor GHS = Globally Harmonized System of Classification and Labelling of Chemicals IATA = International Air Transport Association IBC = Internediate Bulk Container IMDG = International Maritime Dangerous Goods LogPow = logarithm of the octanol/water partition coefficient MARPOL 73/78 = International Convention for the Prevention of Pollution From Ships, 1973 as modified by the Protocol of 1978. ("Marpol" = marine pollution) UN = United Nations

#### Notice to reader

To the best of our knowledge, the information contained herein is accurate. However, neither the above-named supplier, nor any of its subsidiaries, assumes any liability whatsoever for the accuracy or completeness of the information contained herein.

Final determination of suitability of any material is the sole responsibility of the user. All materials may present unknown hazards and should be used with caution. Although certain hazards are described herein, we cannot guarantee that these are the only hazards that exist.